


3. Exploded View & Parts List

3-1 HLP5085WX/XAA


You can search for the updated part code through ITSELF web site.
URL : <http://itself.sec.samsung.co.kr>

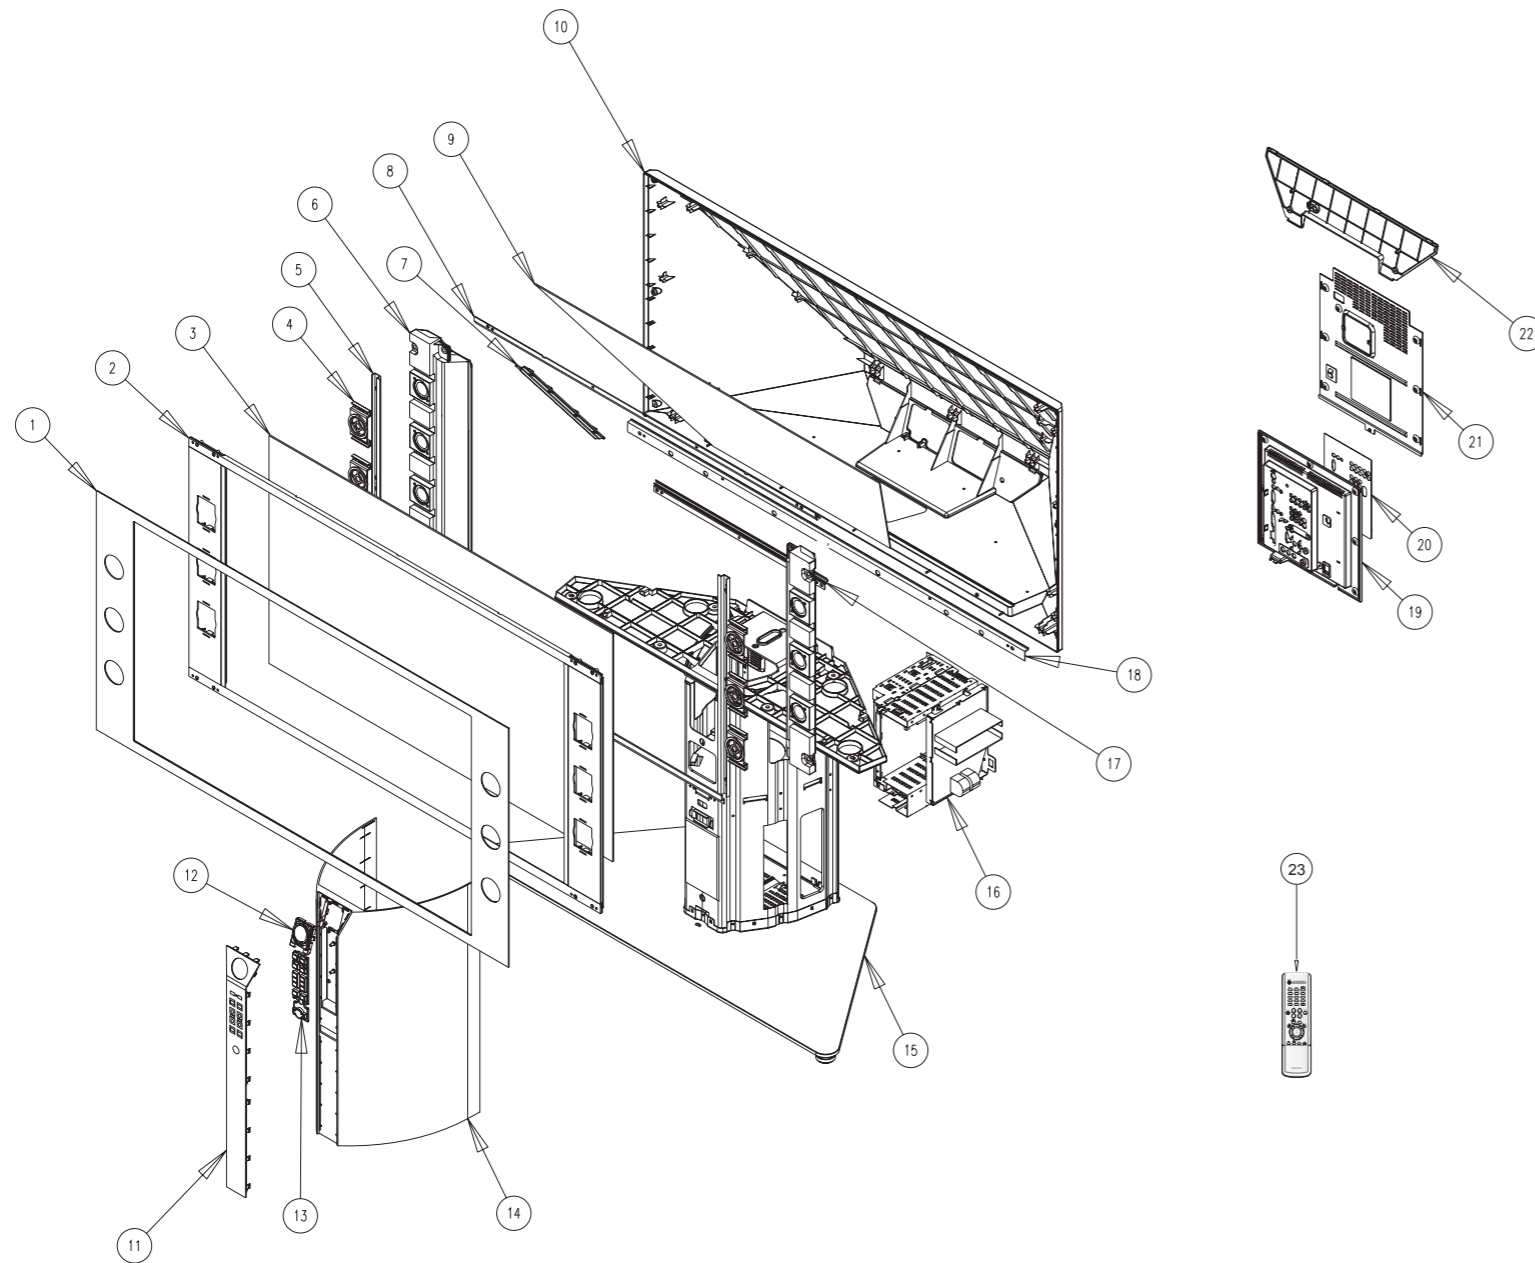

No	Code No	Description;Specification	Q'ty	Loc.No.	S.N.A
1	BP64-00430A	CABINET-MASK;50L7,ACRYL	1	T0021	S.N.A
2	BP64-00428A	CABINET FRONT-L;50L7,HIPS,HB	1		S.N.A
	BP64-00429A	CABINET FRONT-R;50L7,HIPS,HB	1		S.N.A
	BP61-00645A	BRACKET-MASK TOP;50L7,AL,T4.0,EXTR	1		S.N.A
	BP61-00646A	BRACKET-MASK BOT;50L7,AL,T4.0,EXTR	1		S.N.A
	BP61-00647A	BRACKET-MASK SIDE;50L7,AL,T4.0,EXTR	2		S.N.A
3	AA67-00169A	SCREEN LENTI;50W,MS,1128*647,2T	1	T0054	
	BP67-00109A	SCREEN FRESNEL;50W,1126*646,2T	1	T0053	
4	BP96-00603A	ASSY COVER P-HOLDER DECO;50L7,HIPS,HB,GR	6		S.N.A
5	BP61-00643A	BRACKET-SCREEN BOT;50L7,AL,T2.0	1		S.N.A
	BP61-00644A	BRACKET-SCREEN SIDE;50L7,AL,T2.0	1		S.N.A
6	BP96-00615A	ASSY SPEAKER P;8ohm,15W,SEM,L7 speaker a	1	T0175	S.N.A
7	BP61-00635A	HOLDER-MIRROR L;L7,HIPS HB,BLACK	1		S.N.A
	BP61-00636A	HOLDER-MIRROR R;L7,HIPS HB,BLACK	1		S.N.A
8	BP61-00640A	BRACKET-MIRROR TOP;50L7,AL,T2.0	1		S.N.A
9	BP67-00096A	MIRROR;MIRROR FRONT 50,GLASS,1100X580X5	1		S.N.A
10	BP64-00431A	CABINET BACK-TOP;50L7,HIPS,HB,SV-012P	1	M0045	S.N.A
11	BP96-00603A	ASSY COVER P-HOLDER DECO;50L7,HIPS,HB,GR	6		S.N.A
12	BP96-00629A	ASSY COVER P-HOLDER LCD;L7,ABS HB,BLK	1		S.N.A
13	BP96-00628A	ASSY COVER P-HOLDER INDICATOR;L7,ABS,VO	1		S.N.A
14	BP63-00267A	COVER-FRONT;L7,ABS VO,GR503,SVM2012	1	M0112	S.N.A
15	BP96-00621A	ASSY COVER P-MAIN;50L7,SECC+MOLD	1	T0158	S.N.A
16	BP96-00625A	ASSY MISC P-BRKT CHASSIS;50L7,SECC,T1.0	1		S.N.A
17	BP61-00641A	BRACKET-MIRROR BOT;50L7,AL,T2.0	1		S.N.A
18	BP61-00648A	BRACKET-SUPPORT BACK;50L7,AL EXTR,T 2.0,	2		S.N.A
19	BP61-00631A	HOLDER-TERMINAL;L7,HIPS,VO,GRY	1		S.N.A
20	BP64-00419A	INLAY-TERMINAL;L7,PS,T0.5,SEA,SHEET	1	T0071	S.N.A
21	BP63-00264A	COVER-BACK BOT;AL,T2.0,SANINDING80	1		S.N.A
22	BP63-00271A	COVER-BACK REAR;56L7,HIPS,HB,GR503,SV012	1		S.N.A
23	BP59-00048B	REMOCON;DLP,TM76A,47,G6148,EX,SAMSUNG,L6	1	T0074	

3-2 HLP5685WX/XAA

You can search for the updated part code through ITSELF web site.
 URL : <http://itself.sec.samsung.co.kr>

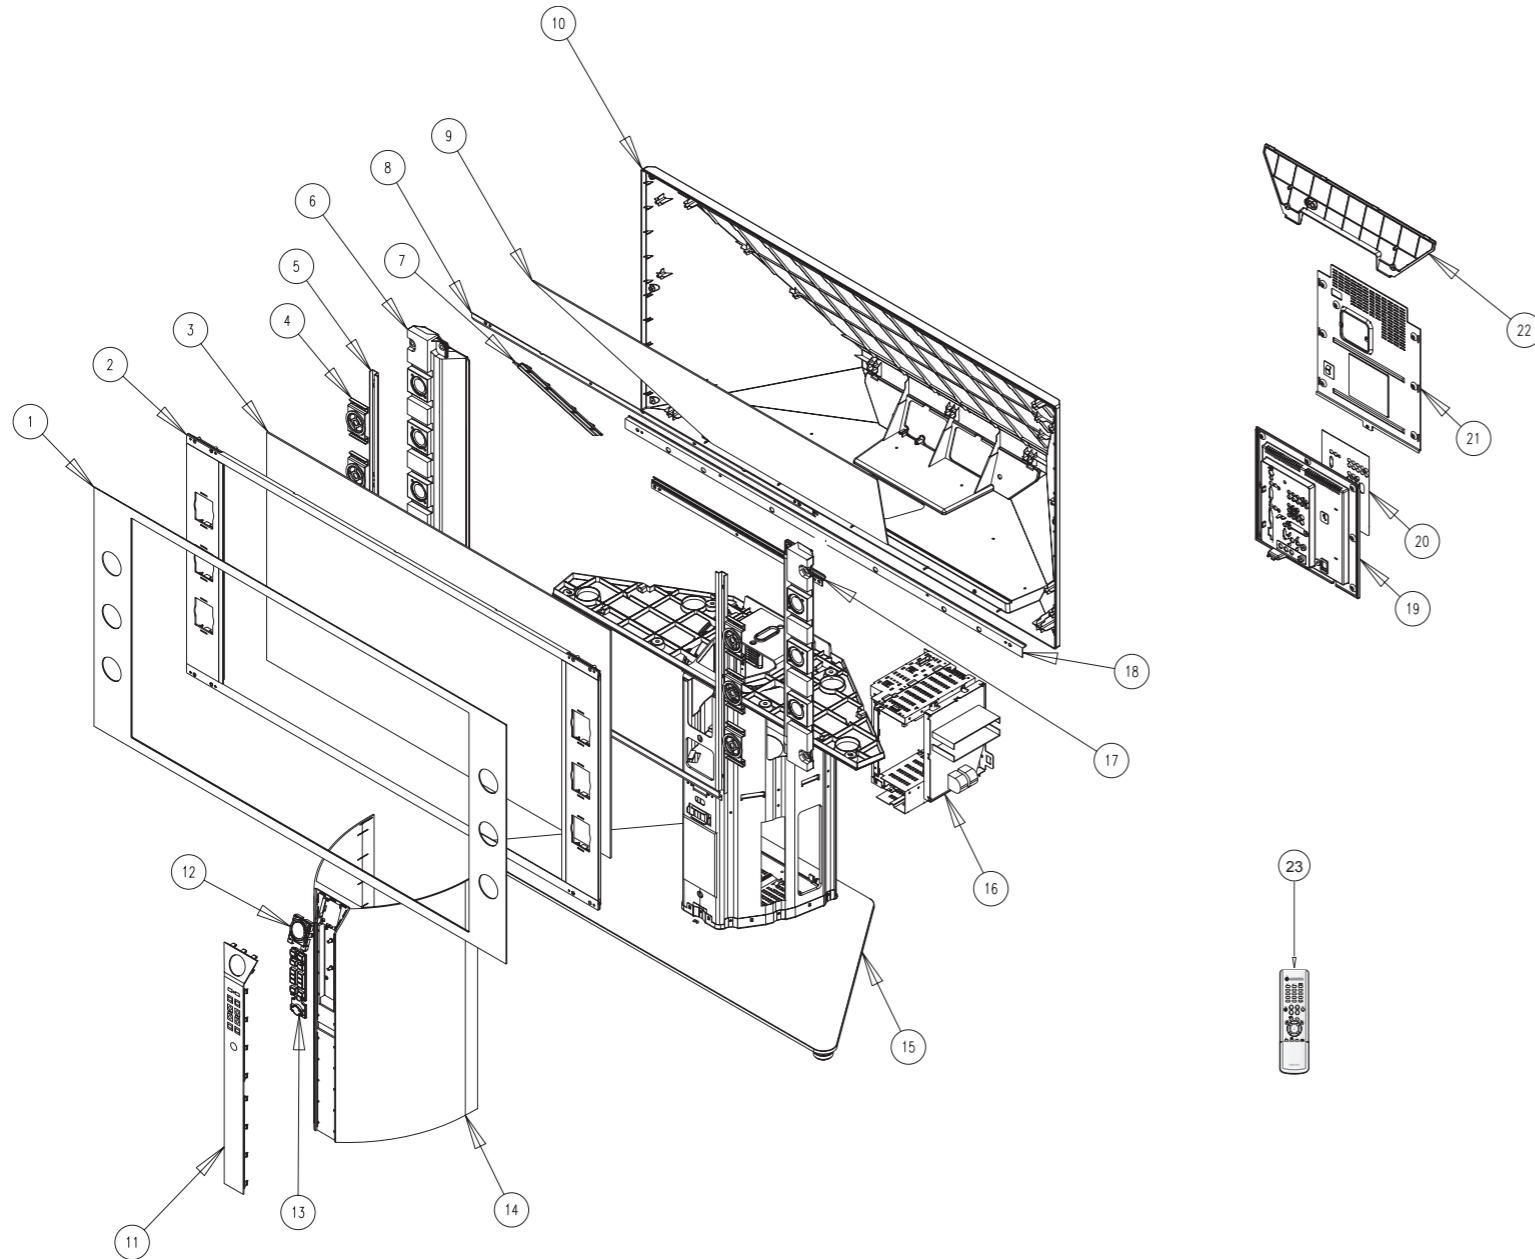

No	Code No	Description;Specification	Q'ty	Loc.No.	S.N.A
1	BP64-00434A	CABINET-MASK;56L7,ACRYL,T2.5,METAL BLK	1	T0021	S.N.A
2	BP64-00432A	CABINET FRONT-L;56L7,HIPS,HB,GR503	1		S.N.A
	BP64-00433A	CABINET FRONT-R;56L7,HIPS,HB,GR503	1		S.N.A
	BP61-00654A	BRACKET-MASK TOP;56L7,AL,T1.6,BLK,EXTR	1		S.N.A
	BP61-00655A	BRACKET-MASK BOT;56L7,AL,T1.6,BLK,EXTR	1		S.N.A
	BP61-00656A	BRACKET-MASK SIDE;56L7,AL,T1.6,BLK,EXTR	2		S.N.A
3	BP67-00110A	SCREEN LENTI;56W,MS,1257*713.5,2T	1	T0054	
	BP67-00111A	SCREEN FRESNEL;56W,1257*713.5,2T	1	T0053	
4	BP96-00628A	ASSY COVER P-HOLDER INDICATOR;L7,ABS,V0,	6		S.N.A
5	BP61-00652A	BRACKET-SCREEN BOT;56L7,AL,T2.0	1		S.N.A
	BP61-00653A	BRACKET-SCREEN SIDE;56L7,AL,T2.0,BLK	1		S.N.A
6	BP96-00615A	ASSY SPEAKER P;8ohm,15W,SEM,L7 speaker a	1	T0175	S.N.A
7	BP61-00635A	HOLDER-MIRROR L;L7,HIPS HB,BLACK	1		S.N.A
	BP61-00636A	HOLDER-MIRROR R;L7,HIPS HB,BLACK	1		S.N.A
8	BP61-00649A	BRACKET-MIRROR TOP;56L7,AL,T1.6,EXTR	1		S.N.A
9	BP67-00097A	MIRROR;Front Mirror 56,GLASS,1279X650X6	1		S.N.A
10	BP64-00435A	CABINET BACK-TOP;56L7,HIPS,HB,GR503,SV01	1	M0045	S.N.A
11	BP96-00603A	ASSY COVER P-HOLDER DECO;50L7,HIPS,HB,GR	6		S.N.A
12	BP96-00629A	ASSY COVER P-HOLDER LCD;L7,ABS HB,BLK	1		S.N.A
13	BP96-00628A	ASSY COVER P-HOLDER INDICATOR;L7,ABS,V0	1		S.N.A
14	BP63-00267A	COVER-FRONT;L7,ABS VO,GR503,SVM2012	1	M0112	S.N.A
15	BP96-00621A	ASSY COVER P-MAIN;50L7,SECC+MOLD	1	T0158	S.N.A
16	BP96-00625A	ASSY MISC P-BRKT CHASSIS;50L7,SECC,T1.0	1		S.N.A
17	BP61-00650A	BRACKET-MIRROR BOT;56L7,AL,T 2.0	1		S.N.A
18	BP61-00657A	BRACKET-SUPPORT BACK;56L7,AL EXTR,T2.0,L	2		S.N.A
19	BP61-00631A	HOLDER-TERMINAL;L7,HIPS,VO,GRY	1		S.N.A
20	BP64-00419A	INLAY-TERMINAL;L7,PS,T0,5,SEA,SHEET	1	T0071	S.N.A
21	BP63-00264A	COVER-BACK BOT;AL,T2.0,SANINDING80	1		S.N.A
22	BP63-00272A	COVER-BACK REAR;56L7,HIPS,HB,GR503,SV012	1		S.N.A
23	BP59-00048B	REMOCON;DLP,TM76A,47,G6148,EX,SAMSUNG,L6	1	T0074	

